



Shoalhaven Hospital Redevelopment

Dust Monitoring Report 13

SYDNEY

9 Sarah St MASCOT NSW 2020 (02) 8339 8000 ABN 98 145 324 714 www.acousticlogic.com.au

The information in this document is the property of Acoustic Logic Pty Ltd 98 145 324 714 and shall be returned on demand. It is issued on the condition that, except with our written permission, it must not be reproduced, copied or communicated to any other party nor be used for any purpose other than that stated in particular enquiry, order or contract with which it is issued.

Project ID	20230220.8
Document Title	Dust Monitoring Report 13
Attention To	John Holland Group Pty Ltd

Revision	Date	Document Reference	Prepared By	Checked By	Approved By
0	21/06/2024	20230220.8/2106A/R0/HD	HD		ТВ

TABLE OF CONTENTS

1 INTRO	DUCTION	4
	ESCRIPTION	
2.1.1	Surrounding Receivers	
3 MONI	TORING LOCATIONS AND DESCRIPTION	
3.1 M	ONITORING PERIOD	8
	ONITORING EQUIPMENT	
	MONITORING	
	ROJECT DOCUMENTATION	
4.1.1	Dust Management Levels	8
4.2 M	ONITORED DUST LEVELS	
4.2.1	East Boundary Facing Shoalhaven Street (Monitor HEX-000171)	10
4.2.2	North Boundary Facing Block A & B (Monitor HEX-000130)	11
4.2.3	West of Early Works Zone (Monitor HEX-000232)	
4.2.4	Pre-School Boundary (Monitor HEX-000401)	13
4.3 DI	SCUSSION	14
4.3.1	East Boundary Opposite Shoalhaven Street Residences (HEX-000171)	14
4.3.2	North Boundary Near Block A and B (HEX-000130)	14
4.3.3	West of Early Works Zone Near Block A (HEX-000232)	14
4.3.4	Pre-School Boundary Near Outdoor Play Area (HEX-000401)	14
4.4 M	ANAGEMENT OF DUST LEVELS	15
5 CONC	LUSION	16
APPENDIX	A – DUST MONITORING GRAPHS	17

1 INTRODUCTION

This report presents the results of dust monitoring conducted by Acoustic Logic for the Shoalhaven Hospital Redevelopment project site. Details presented in this report include monitoring locations, relevant project objectives, measured levels over the monitoring period and discussion of results.

This report presents the results of monitoring for the month of June between 1/6/2024 and 30/6/2024. Monitoring has been ongoing since 29th May 2023.

This report should be read in conjunction with the Construction Noise, Dust and Vibration Management Sub Plan prepared by this office (ref: 20230220.1/0506A/R1/VF, dated 05/06/2023)

2 SITE DESCRIPTION

The project site is located at Shoalhaven Hospital Redevelopment. Bulk excavation works and concrete pours are currently being undertaken across the project site.

2.1.1 Surrounding Receivers

Based on site investigations, the following developments surround the site:

Table 1 - Sensitive Receivers

Receiver (Refer Figure 1)	Receiver Type	Comment
R1	Residential	Detached dwellings to south of North Street, and residences and St Michaels Catholic Church and school to the east.
R2	Residential	Detached dwellings to north east, opposite Shoalhaven Street with some health and commercial and recreational uses.
PS	School	Shoalhaven Community Pre-School (future relocated site).
СС	Hospital	Cancer Centre overnight accommodation (part of the greater hospital site).

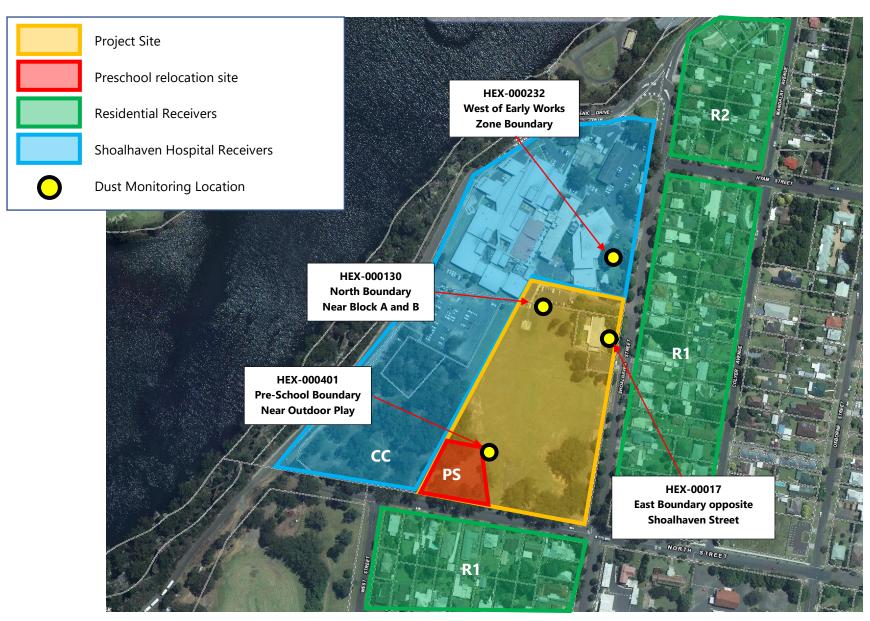


Figure 1 – Site Map. Monitoring Locations and Surrounding Receivers

3 MONITORING LOCATIONS AND DESCRIPTION

Refer to Figure 1 and photos below for monitoring locations.



Figure 2 – HEX000171 –-East Boundary Opposite Shoalhaven Street (left) and HEX000131 – North Boundary Near Block A and B (right)



Figure 3 - HEX000232 - West of Early Works Zone Near Block A





Figure 4 - HEX000401 - Pre-School Boundary Fence Near Outdoor Play Area

3.1 MONITORING PERIOD

This report presents the results of monitoring between 1/6/2024 and 30/6/2024.

Monitoring has been ongoing since 29th May 2023.

3.2 MONITORING EQUIPMENT

Dust monitoring was conducted using SiteHive Hexanode monitors. Monitors are programmed to continuously store noise data over every 15-minute period

4 DUST MONITORING

4.1 PROJECT DOCUMENTATION

Construction impacts to nearby development have been determined in the Construction Noise, Dust and Vibration Management Sub Plan (ref: 20230220.1/0506A/R1/VF, dated 05/06/2023)

4.1.1 **Dust Management Levels**

Dust monitoring is conducted to measure mechanically generated respirable PM_{10} dust particles (< $10\mu m$) and $PM_{2.5}$ dust particles (< $2.5\mu m$), which are generally understood to be the main health concern in airborne dust. The air quality limits are based on the standards outlined in Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure* and NSW EPA's air quality categories.

It should be noted that the dust monitoring results can be influenced by events such as fires, fogs and dust storms, thus the PM10 limit has an allowance of 5 days per year to account for the effects of these two effects. It is noted that site dust suppression systems using fine water sprays can affect the dust count of laser-based measurement systems and so too can pollen in Spring. The PM₁₀ and PM_{2.5} goals are summarised below.

Table 2 – PM₁₀ and PM_{2.5} Goals (24-Hour Average)

Pollutant	Averaging Time	Maximum Concentration
Particulate Matter PM ₁₀	24 hours	50 μg/m³
Particulate Matter PM _{2.5}	24 hours	25 μg/m³

The EPA has air quality categories based on particle concentration over a one-hour average. These levels may be used to control site dust emissions. Typically, a project alert trigger level is set on the 'Poor' category level. **However, the assessment level is based on the 24-hour average**.

Table 3 – PM₁₀ and PM_{2.5} Goals (1-Hour Average)

Dellestant	Air Quality Category (AQC)						
Pollutant	Good	Fair	Poor	Very Poor	Extremely Poor		
Particulate Matter PM ₁₀ (μg/m³)	< 50	50-100	100-200	200-600	600 and above		
Particulate Matter PM _{2.5} (μg/m³)	< 25	25-50	50-100	100-300	300 and above		

4.2 MONITORED DUST LEVELS

The following legend has been generated with reference to exceedances within the monitored dust levels as follows and applied to the tables below.

RED = TRUE EXCEEDANCE

BLUE = EXCEEDANCES DURING WEATHER AFFECTED PERIODS

GREY = EXCEEDANCES DURING OUT OF HOURS

Where true exceedances are recorded, additional analysis has been provided in the discussion below.

4.2.1 East Boundary Facing Shoalhaven Street (Monitor HEX-000171)

The daily average PM_{2.5} and PM₁₀ concentration levels are presented below:

Table 4 – East Boundary (HEX-000171) Daily Average PM₁₀ and PM_{2.5} Concentration

	24hr Average PM _{2.5} and PM ₁₀ Concentration					
Date	PM _{2.5} Level (μg/m³)	PM _{2.5} Limit (μg/m³)	Compliance	PM ₁₀ Level (μg/m³)	PM ₁₀ Limit (μg/m³)	Compliance
1/06/2024	10		Yes	29		Yes
2/06/2024	2	-	Yes	11		Yes
3/06/2024	3		Yes	24		Yes
4/06/2024	4		Yes	34		Yes
5/06/2024	8		Yes	37		Yes
6/06/2024	17		Yes	63		Yes
7/06/2024	7		Yes	27		Yes
8/06/2024	1		Yes	7		Yes
9/06/2024	2		Yes	6		Yes
10/06/2024	3		Yes	8		Yes
11/06/2024	2		Yes	14		Yes
12/06/2024	5		Yes	32		Yes
13/06/2024	6		Yes	44		Yes
14/06/2024	5		Yes	34		Yes
15/06/2024	4	25	Yes	10	50	Yes
16/06/2024	1	25	Yes	5	50	Yes
17/06/2024	5		Yes	42		Yes
18/06/2024	5		Yes	36		Yes
19/06/2024	8		Yes	62		No
20/06/2024	7		Yes	47		Yes
21/06/2024	6		Yes	38		Yes
22/06/2024	4		Yes	18		Yes
23/06/2024	3		Yes	11		Yes
24/06/2024	5		Yes	39		Yes
25/06/2024	7		Yes	47		Yes
26/06/2024	7		Yes	50		Yes
27/06/2024	7		Yes	59		Yes
28/06/2024	7		Yes	57		No
29/06/2024	3		Yes	15		Yes
30/06/2024	4		Yes	12		Yes

RED = TRUE EXCEEDANCE

BLUE = COMPLIES - EXCEEDANCES DURING WEATHER AFFECTED PERIODS

4.2.2 North Boundary Facing Block A & B (Monitor HEX-000130)

The daily average PM_{2.5} and PM₁₀ concentration levels are presented below:

Table 5 - North Boundary (HEX-000130) Daily Average PM₁₀ and PM_{2.5} Concentration

	24hr Average PM _{2.5} and PM ₁₀ Concentration					
Date	PM _{2.5} Level (µg/m³)	PM _{2.5} Limit (μg/m³)	Compliance	PM ₁₀ Level (μg/m³)	PM ₁₀ Limit (μg/m³)	Compliance
1/06/2024	4		Yes	9		Yes
2/06/2024	1		Yes	2		Yes
3/06/2024	1		Yes	2		Yes
4/06/2024	1		Yes	2		Yes
5/06/2024	1		Yes	4		Yes
6/06/2024	7		Yes	22		Yes
7/06/2024	3		Yes	8		Yes
8/06/2024	1		Yes	2		Yes
9/06/2024	1		Yes	1		Yes
10/06/2024	1		Yes	2		Yes
11/06/2024	1		Yes	2		Yes
12/06/2024	1		Yes	3		Yes
13/06/2024	1		Yes	3		Yes
14/06/2024	1		Yes	3		Yes
15/06/2024	2	25	Yes	5	F0	Yes
16/06/2024	0	25	Yes	1	50	Yes
17/06/2024	1		Yes	2		Yes
18/06/2024	1		Yes	2		Yes
19/06/2024	1		Yes	1		Yes
20/06/2024	2		Yes	4		Yes
21/06/2024	1		Yes	3		Yes
22/06/2024	1		Yes	3		Yes
23/06/2024	1		Yes	3		Yes
24/06/2024			Yes			Yes
25/06/2024	1		Yes	5		Yes
26/06/2024	1		Yes	3		Yes
27/06/2024	1		Yes	2		Yes
28/06/2024	1		Yes	3		Yes
29/06/2024	1		Yes	3		Yes
30/06/2024	2		Yes	5		Yes

RED = TRUE EXCEEDANCE

BLUE = COMPLIES - EXCEEDANCES DURING WEATHER AFFECTED PERIODS

4.2.3 West of Early Works Zone (Monitor HEX-000232)

The daily average PM_{2.5} and PM₁₀ concentration levels are presented below:

Table 6 – West of Early Works (HEX-000232) Daily Average PM₁₀ and PM_{2.5} Concentration

	24hr Average PM _{2.5} and PM ₁₀ Concentration					
Date	PM _{2.5} Level (μg/m³)	PM _{2.5} Limit (μg/m³)	Compliance	PM ₁₀ Level (μg/m³)	PM ₁₀ Limit (μg/m³)	Compliance
1/06/2024	6		Yes	18		Yes
2/06/2024	2		Yes	7		Yes
3/06/2024	1		Yes	3		Yes
4/06/2024	1		Yes	3		Yes
5/06/2024	2		Yes	10		Yes
6/06/2024	8		Yes	28		Yes
7/06/2024	6		Yes	21		Yes
8/06/2024	1		Yes	4		Yes
9/06/2024	1		Yes	3		Yes
10/06/2024	2		Yes	5		Yes
11/06/2024	1		Yes	4		Yes
12/06/2024	3		Yes	8		Yes
13/06/2024	2		Yes	7		Yes
14/06/2024	2		Yes	9		Yes
15/06/2024	2	25	Yes	6		Yes
16/06/2024	1	25	Yes	2	50	Yes
17/06/2024	2		Yes	13		Yes
18/06/2024	2		Yes	12		Yes
19/06/2024	1		Yes	7		Yes
20/06/2024	3		Yes	12		Yes
21/06/2024	2		Yes	14		Yes
22/06/2024	3		Yes	12		Yes
23/06/2024	2		Yes	7		Yes
24/06/2024	2		Yes	10		Yes
25/06/2024	2		Yes	10		Yes
26/06/2024	4		Yes	16		Yes
27/06/2024	2		Yes	11		Yes
28/06/2024	2		Yes	13		Yes
29/06/2024	2		Yes	6		Yes
30/06/2024	2		Yes	7		Yes

RED = TRUE EXCEEDANCE

BLUE = COMPLIES - EXCEEDANCES DURING WEATHER AFFECTED PERIODS

4.2.4 Pre-School Boundary (Monitor HEX-000401)

The daily average PM_{2.5} and PM₁₀ concentration levels are presented below:

Table 7 - Pre-School Boundary (HEX-000401) Daily Average PM₁₀ and PM_{2.5} Concentration

	24hr Average PM _{2.5} and PM ₁₀ Concentration					
Date	PM _{2.5} Level (μg/m³)	PM _{2.5} Limit (μg/m³)	Compliance	PM ₁₀ Level (μg/m³)	PM ₁₀ Limit (μg/m³)	Compliance
1/06/2024	5		Yes	15		Yes
2/06/2024	1		Yes	4		Yes
3/06/2024	1		Yes	15		Yes
4/06/2024	2		Yes	24		Yes
5/06/2024	2		Yes	8		Yes
6/06/2024	8		Yes	39		Yes
7/06/2024	4		Yes	16		Yes
8/06/2024	1		Yes	4		Yes
9/06/2024	1		Yes	2		Yes
10/06/2024	2		Yes	4		Yes
11/06/2024	1		Yes	4		Yes
12/06/2024	2		Yes	9		Yes
13/06/2024	1		Yes	5		Yes
14/06/2024	2		Yes	7		Yes
15/06/2024	2	25	Yes	5	50	Yes
16/06/2024	1	25	Yes	2	50	Yes
17/06/2024	1		Yes	5		Yes
18/06/2024	1		Yes	6		Yes
19/06/2024	1		Yes	7		Yes
20/06/2024	2		Yes	13		Yes
21/06/2024	2		Yes	13		Yes
22/06/2024	3		Yes	13		Yes
23/06/2024	2		Yes	7		Yes
24/06/2024	1		Yes	6		Yes
25/06/2024	2		Yes	8		Yes
26/06/2024	2		Yes	17		Yes
27/06/2024	0		Yes	0		Yes
28/06/2024	0		Yes	0		Yes
29/06/2024	0		Yes	0		Yes
30/06/2024	0		Yes	0		Yes

RED = TRUE EXCEEDANCE

BLUE = COMPLIES - EXCEEDANCES DURING WEATHER AFFECTED PERIODS

4.3 DISCUSSION

4.3.1 East Boundary Opposite Shoalhaven Street Residences (HEX-000171)

- During the monitoring period, PM_{2.5} dust levels at the monitoring location were found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.
- During the monitoring period, PM₁₀ dust levels at the monitoring location were generally found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.
- True exceedances of the daily average occurred on the following dates and categories:
 - o 19th June PM₁₀
 - The dust level averaged over the 24-hour period was above the recommended level on this date.
 - We note high winds (WNW) were generally prevalent on this date and may have contributed to the dust exceedances.
 - o 28th May PM₁₀
 - The dust level averaged over the 24-hour period was above the recommended level on this date.
 - We note high winds (WNW) were generally prevalent on this date and may have contributed to the dust exceedances.
 - Weather affected periods occurred during 2am-10am and 6pm-10pm.

4.3.2 North Boundary Near Block A and B (HEX-000130)

- During the monitoring period, PM_{2.5} dust levels at the monitoring location were found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.
- During the monitoring period, PM₁₀ dust levels at the monitoring location were found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.

4.3.3 West of Early Works Zone Near Block A (HEX-000232)

- During the monitoring period, PM_{2.5} dust levels at the monitoring location were found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.
- During the monitoring period, PM₁₀ dust levels at the monitoring location were generally found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.

4.3.4 Pre-School Boundary Near Outdoor Play Area (HEX-000401)

- During the monitoring period, PM_{2.5} dust levels at the monitoring location were found to be within the maximum concentration permitted by Department of the Environment's National Environment Protection (Ambient Air Quality) Measure.
- During the monitoring period, PM₁₀ dust levels at the monitoring location were generally found to be within the maximum concentration permitted by Department of the Environment's *National Environment Protection (Ambient Air Quality) Measure*.

4.4 MANAGEMENT OF DUST LEVELS

General Notes:

• It should be noted that the measured dust levels will also be affected by meteorological events outside the project site, such as heavy rain and wind, high humidity, dust storms, bush fires, high pollen count and the like.

Response to Exceedances

The response procedures adopted by JH are as follows:

- The project team is notified via SMS alert messages when hourly average dust levels are exceeded
- Methodology and works across the project site and near to the specific monitoring location are recorded.
- Where monitoring locations are confirmed to be potentially impacted by the adjacent works (i.e.,
 where exceedance notifications are received but no works are occurring near to the monitoring
 location indicating alerts are as a result of external impacts refer general notes in Section 4.3.4),
 work methodology was investigated and mistor(s) are deployed.

Acoustic Logic confirms JH has implemented best practices as well as reasonable and feasible mitigation measures in response to dust exceedances over the majority of this monitoring period.

A review of works on the days that led to exceedance of dust levels should be carried out and the following additional recommendations for ongoing dust management should be implemented:

- Loose soil and/or dusty stockpiles should be covered with tarpaulin/plastic sheeting outside of working hours and during extended periods where not in use.
- Minimisation/relocation of stockpiles away from dust-sensitive receivers to minimise potential for disturbance due to prevailing winds.
- Additional dust suppression methods such as directed water sprays directly onto excavation equipment and work areas should be implemented where alternative methodology cannot be found.

5 CONCLUSION

Dust monitoring has been conducted at different locations for the Shoalhaven Hospital Redevelopment between 1/6/2024 and 30/6/2024.For this monitoring period, we note the following:

- Hexanode HEX-000171 at the East Boundary PM_{2.5} and PM₁₀ dust levels were generally within the criteria during this monitoring period.
- Hexanode HEX-000130 at the North Boundary PM_{2.5} and PM₁₀ dust levels were generally within the criteria during this monitoring period.
- Hexanode HEX-000232 at the West of Early Works Zone PM_{2,5} and PM₁₀ dust levels were generally
 within the criteria during this monitoring period.
- Hexanode HEX-000401 at the Preschool PM_{2.5} and PM₁₀ dust levels were generally within the criteria during this monitoring period.

On dates where exceedances have occurred, these have been documented for further review and remedial action for JH review.

We trust this information is satisfactory. Please contact us should you have any further queries.

Yours faithfully,


Acoustic Logic Pty Ltd

Hyde Deng

APPENDIX A – DUST MONITORING GRAPHS




North Boundary Near Block A and B

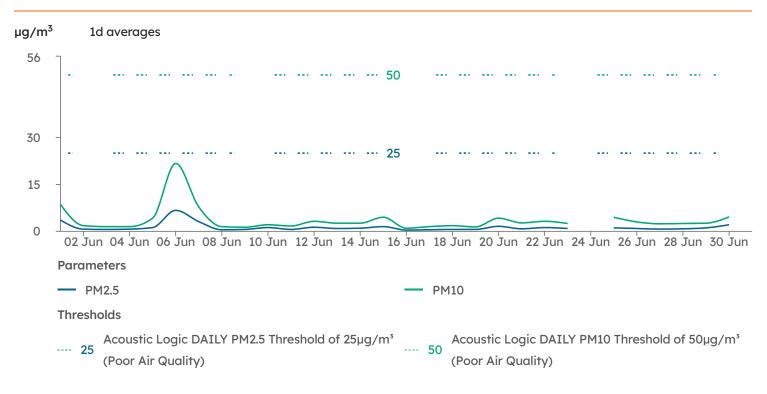




East Boundary Near Shoalhaven Street

01 Jun 2024 - 30 Jun 2024

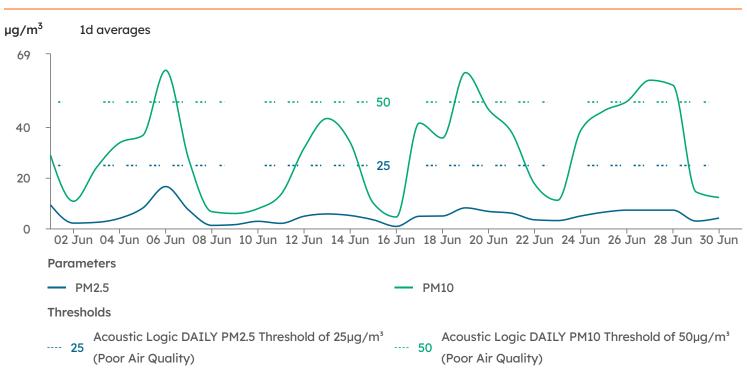




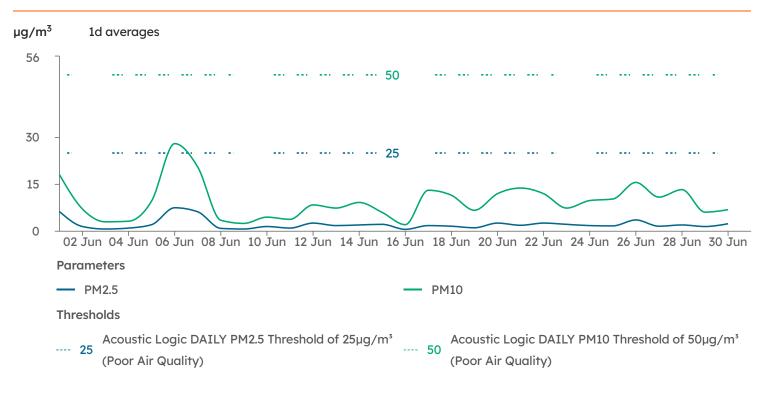



Near Pre-School

01 Jun 2024 - 30 Jun 2024

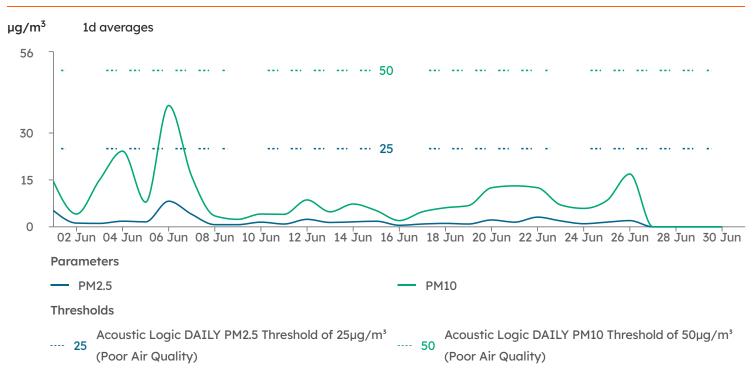

ח	evice	Detail	IS.
_	~ * : ~ ~	DC:011	

Device Serial	Monitoring Points	Model	Calibration Date	Calibration Due
HEX-000171	East Boundary Near Shoalhaven Street	SiteHive Hexanode	03 Apr 2023	03 Apr 2025
HEX-000130	North Boundary Near Block A and B	SiteHive Hexanode	21 Apr 2023	21 Apr 2025
HEX-000232	West of Early Works Zone	SiteHive Hexanode	29 May 2023	29 May 2025
HEX-000401	Near Pre-School	SiteHive Hexanode	28 Aug 2023	28 Aug 2025